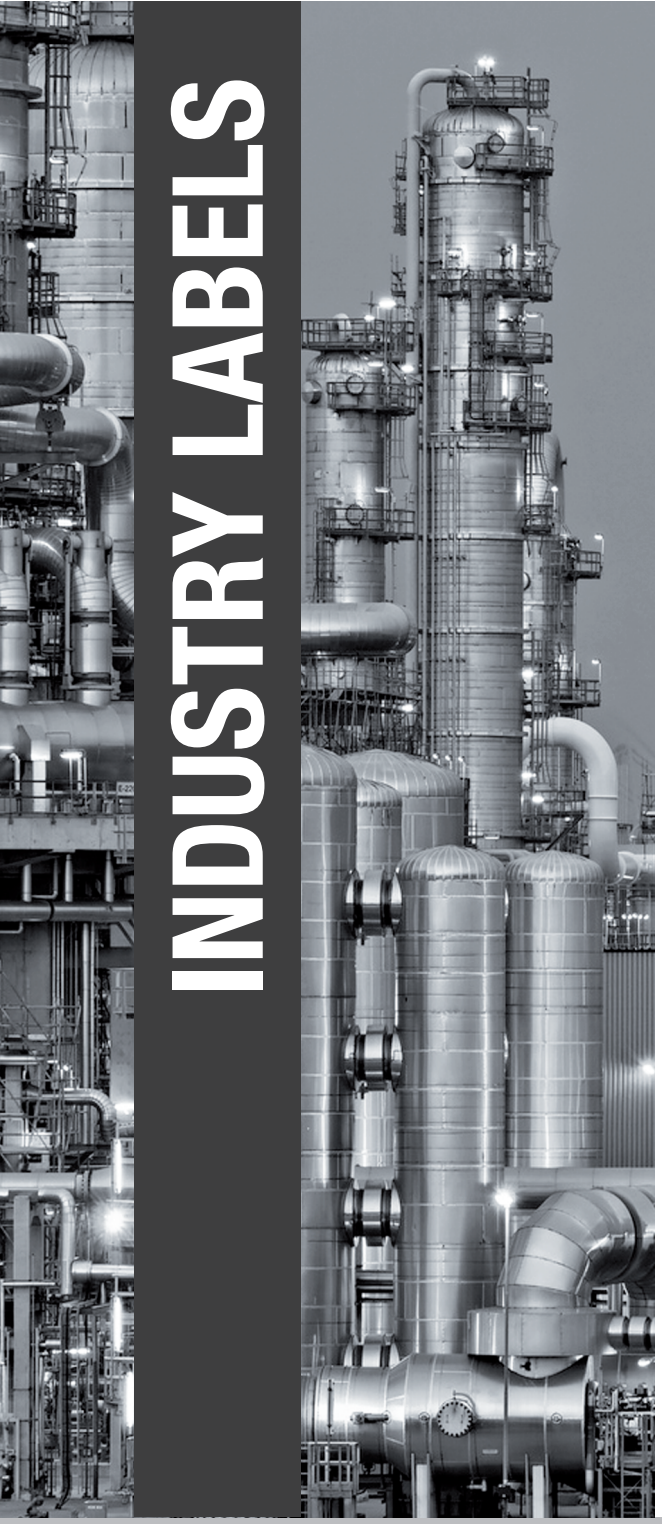

INDUSTRY LABELS

LabelMax XL

Quick Installation Guide

MAX Systems GmbH • Am Bauhof 12 • 27442 Gnarrenburg
Tel.: +49 (0) 47 63 / 945 95 - 10 • Fax: +49 (0) 47 63 / 945 95 - 11
E-Mail: info@maxsystems.eu • www.maxsystems.eu

Loading Media

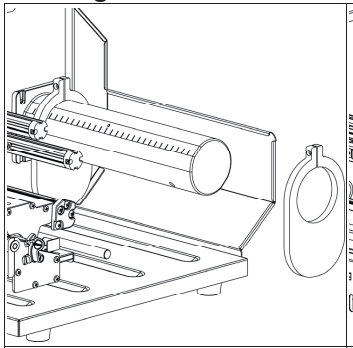

(1) Remove ONE label rollguard.

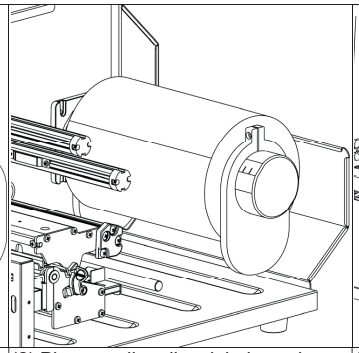

(2) Place media roll on label supply spindle. Replace label rollguard.
Note: Make sure the media is set at the center of spindle.

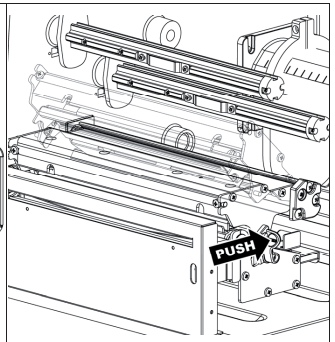

(3) Push the printhead release lever to open the printhead mechanism.

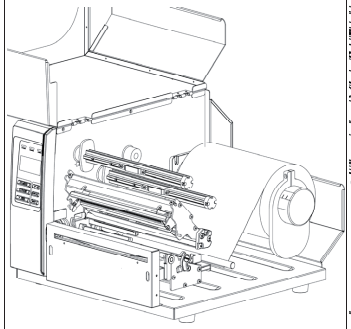

(4) Pull the leading edge of the label forward through the media guide bar past media sensor, and place the leading edge onto the platen roller.

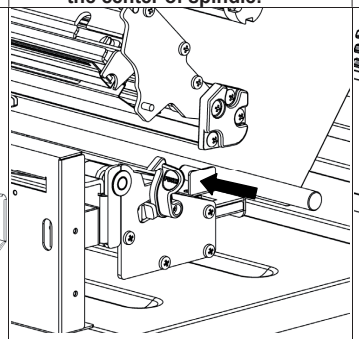

(5) Adjust the label guide to fit label width.

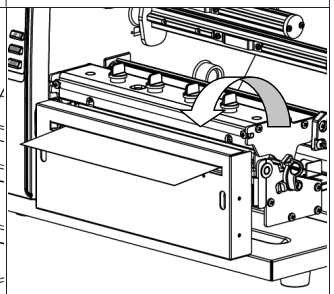

(6) Close printhead mechanism, making sure the latches are engaged properly.

Loading path for media

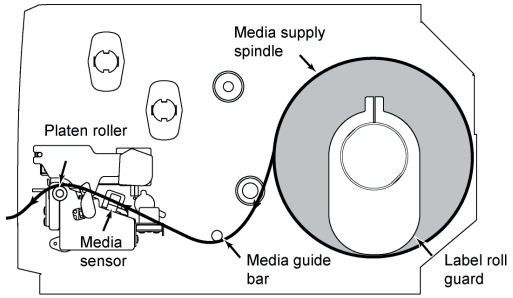

(7) Using the front display panel, set media sensor type and calibrate the selected sensor (See “Media Sensor Calibration” on facing page).
Note: Re-calibrate the gap/black-mark sensors when changing media.

Control Panel

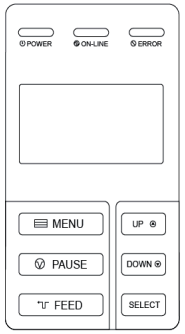

LED	Status	Indication
POWER	Off	Printer power off
	On	Printer power on
ON-LINE	On	Printer is ready
	Blinking	Printer is paused
		Printer is downloading data
ERROR	Off	Printer is ready
	On	Carriage open OR Cutter error
	Blinking	No paper, Paper jam OR No ribbon

Keys	Function
MENU	1. Enter the menu system 2. Once in the menu system, return to previous menu. If at menu root, exits the menu system.
PAUSE	Pauses or resumes printing
FEED	Advances one label
UP	Scroll up the menu options
DOWN	Scroll down the menu options
SELECT	Select the currently highlighted option

MAX Systems GmbH • Am Bauhof 12 • 27442 Gnarrenburg
Tel.: +49 (0) 47 63 / 945 95 - 10 • Fax: +49 (0) 47 63 / 945 95 - 11
E-Mail: info@maxsystems.eu • www.maxsystems.eu

Quick Installation Guide

Printer Overview

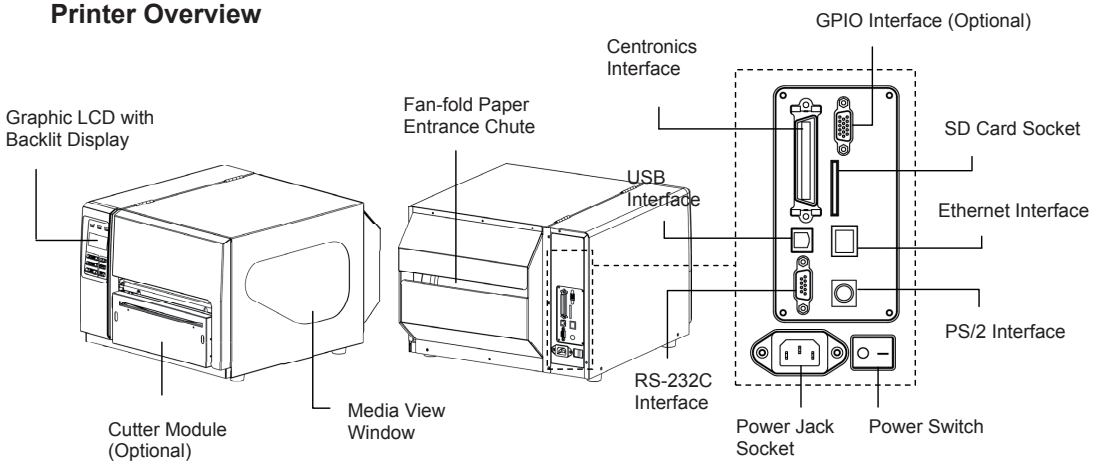

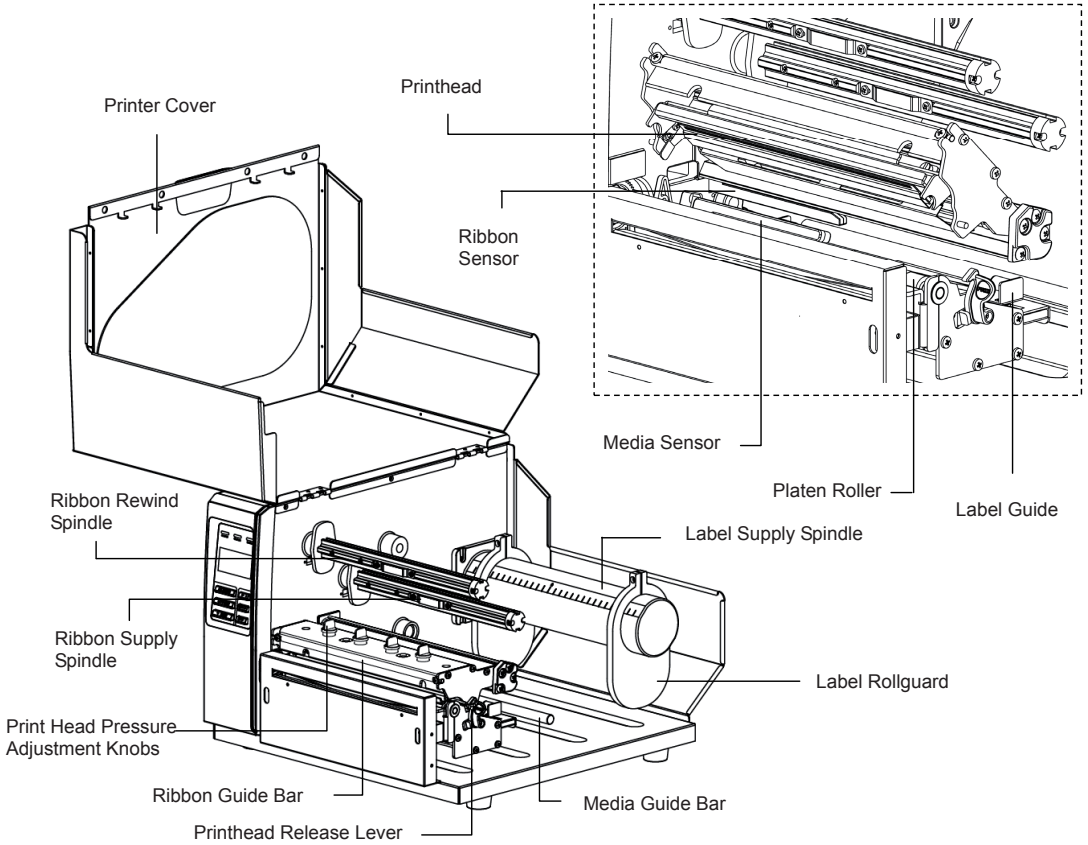

Loading Ribbon

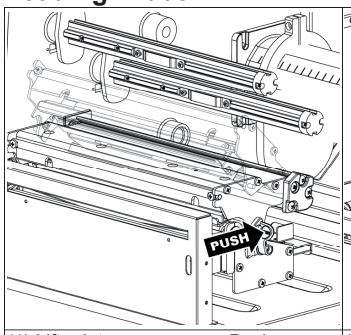

(1) Lift printer cover open. Push printhead release lever to open printhead mechanism.

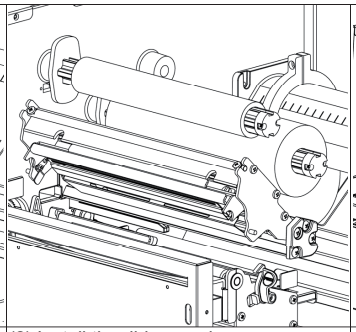

(2) Install the ribbon and paper core onto ribbon supply spindle and ribbon rewind spindle.
Note: Make sure the ribbon and paper cores are set at the center of the spindle.

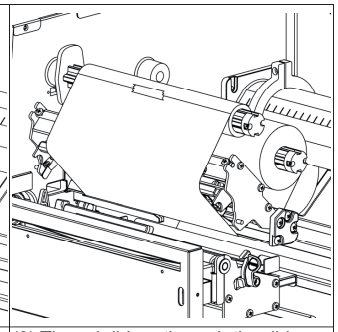

(3) Thread ribbon through the ribbon sensor slot and printhead. Stick ribbon onto ribbon rewind paper core, keeping the ribbon flat and wrinkle-free.

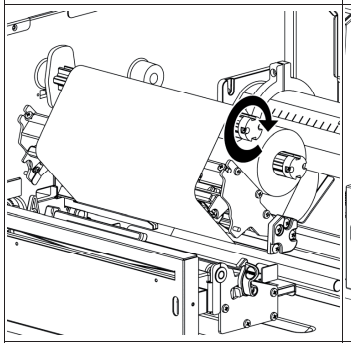

(4) Wind the ribbon rewind spindle clockwise roughly 3~5 circles until ribbon is smooth, properly stretched and wrinkle-free.

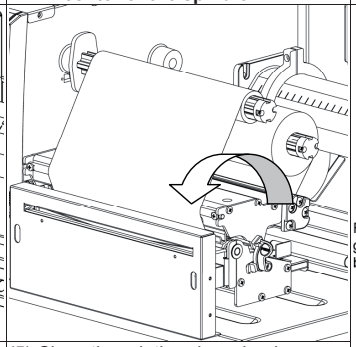

(5) Close the printhead mechanism, making sure the latches are engaged properly.

Loading path for ribbon

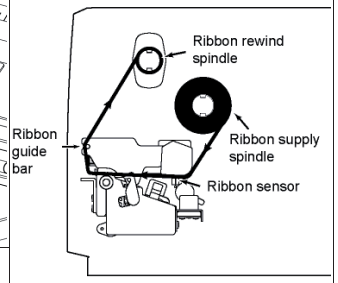

Replace Ribbon

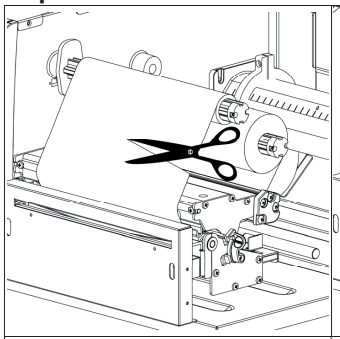

(1) Break the ribbon between the ribbon guide bar and ribbon rewind spindle.

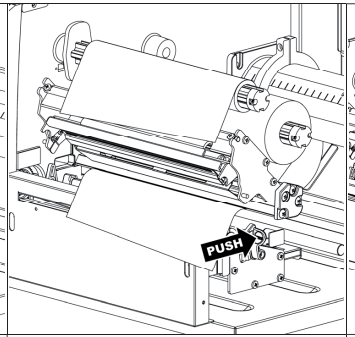

(2) Push the printhead release lever to open the printhead mechanism.

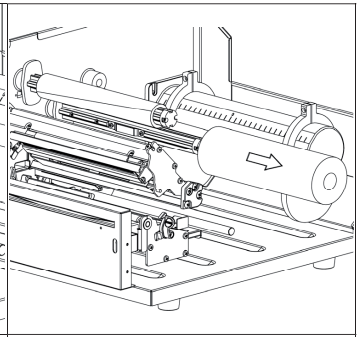

(3) Slide the ribbon off from the ribbon rewind spindle.